



ULTRACRETE MANUFACTURING AND GLOBAL DISTRIBUTION



ULTRACRETE-TX1000

GENERAL SPRAY TEXTURING PROCEDURES

1. REMOVE EXISTING COATINGS, IF NECESSARY.
2. CHASE ANY SUBSTRAIGHT CRACKS WITH A V-BLADE GRINDER TO OPEN THEM UP.
3. PRESSURE WASH SURFACE WITH 3000PSI MINIMUM. REMOVE ANY STAINS THAT COULD INTERFERE WITH BOND. (ACID ETCH AND NEUTRALIZE, IF NECESSARY)
4. AFTER SURFACE IS DRY, REPAIR SUBSTRAIGHT CRACKS WITH PROPER MATERIALS. ANY EXPOSED (SURFACE) MATERIAL SHOULD BE GROUND DOWN TO ROUGHEN UP.
5. MASK OFF AREA TO PROTECT THE PROJECT ACCORDINGLY.
6. PREPARE AN AREA FOR MIXING.
7. USING A ½” DRILL MOTOR (MUD MIXER) AND AN EGG BEATER STYLE MIXER, MIX *ULTRACRETE-TX1000* FOR SPRAY TEXTURING - ONE GALLON OF COOL WATER FOR 50 POUND BAG TO START. ADD ADDITIONAL WATER TO ACHIEVE DESIRED CONSISTANCY. DO NOT ADD TOO MUCH WATER. (A CEMENT MIXER IS NOT RECOMMENDED).
8. USING A CHIP BRUSH, PRE-COAT EXPANSION JOINTS AND EDGES WITH MIXED *ULTRACRETE-TX1000*.
9. IF PATTERNING, APPLY A TINTED BASE COAT WHILE KEEPING EXPANSION JOINTS FREE OF MATERIAL BUILD-UP. AFTER BASE COAT IS COMPLETELY DRY, APPLY PATTERN OF CHOICE CHOOSING PATTERN FIBER TAPE OR STENCILS. (OMIT THIS STEP IF NOT PATTERNING).
10. SPRAY *ULTRACRETE-TX1000* FROM A TEXTURING GUN OF YOUR CHOICE AND SPRAY TEXTURE FOR DESIRED LOOK. KNOCK DOWN TEXTURE WITH A CLEAN TROWEL FOR A “KNOCK DOWN LACE” LOOK IF DESIRED. SPIKE SHOES ARE RECOMMENDED.
11. IF PATTERNED, PULL PATTERNING TAPE STENCIL TO EXPOSE PATTERN (VERY IMPORTANT TO DO THIS BEFORE *ULTRACRETE-TX1000* CURES).
12. AFTER COMPLETELY DRY (GENERALLY NEXT DAY) USE THE BLADE SCRAPER TO KNOCK OFF LOOSE PRODUCT AND THEN GROOM OR BLOW CLEAN.
13. COLOR PROJECT WITH COLORING SYSTEM AND METHOD OF YOUR CHOICE, AVOIDING PATTERN LINES.
14. ROLL OR SPRAY-APPLY SEALER OF YOUR CHOICE FOLLOW MANUFACTURER’S DIRECTIONS.
15. REMOVE ANY REMAINING PROTECTIVE TAPE.

1-877-485-8721

WWW.ULTRACRETE.COM

EMAIL: WWW.INFO@ULTRACRETE.COM